


NEU HOT + 0-10VDC CONTROL SIGNAL

120VAC POWER SUPPLY 4-20mA CONTROL SIGNAL

FIELD WIRING

REV.	DESCRIPTION	DATE	BY
1	REDRAWN; NEW AUX. SWITCH WIRE COLORS & ADD BRAKE	20JUN16	WJR

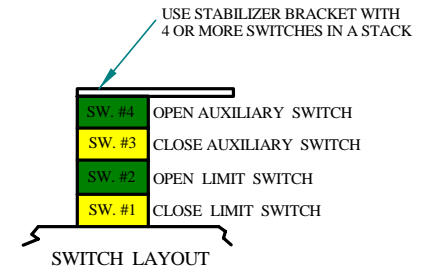

NOTES:
 ACTUATOR SHIPPED IN OPEN POSITION.
 20mA REPRESENTS OPEN POSITION.
 DO NOT ADJUST FEEDBACK POTENTIOMETER OR LIMIT SWITCHES THEY ARE FACTORY SET AND DO NOT REQUIRE CALIBRATION.
 TO CALIBRATE THE OPEN AND CLOSE POSITION USE THE ZERO (4mA) AND SPAN (20mA) TRIM POTENTIOMETERS, FOR DETAILS SEE THE MANUAL.
 THE TORQUE SWITCH MAY REQUIRE ADDITIONAL CALIBRATION.

I_CI		Indelac Controls, Inc.	
		Florence, Ky. 41042	
WIRING DIAGRAM, K SERIES ACTUATOR WITH 4-20mA POSITIONER, OPTIONAL TWO AUXILIARY SWITCHES, BRAKE AND HEATER & THERMOSTAT			
JLR	11-10-2010	W101110	